

PIC24FV32KA304 Family Silicon Errata and Data Sheet Clarification

The PIC24FV32KA304 family devices that you have received conform functionally to the current Device Data Sheet (DS39995**D**), except for the anomalies described in this document.

The silicon issues discussed in the following pages are for silicon revisions with the Device and Revision IDs listed in Table 1. The silicon issues are summarized in Table 2.

The errata described in this document will be addressed in future revisions of the PIC24FV32KA304 family silicon.

Note: This document summarizes all silicon errata issues from all revisions of silicon, previous as well as current. Only the issues indicated in the last column of Table 2 apply to the current silicon revision (A7).

Data sheet clarifications and corrections start on Page 6, following the discussion of silicon issues.

The silicon revision level can be identified using the current version of MPLAB® IDE and Microchip's programmers, debuggers and emulation tools, which are available at the Microchip corporate web site (www.microchip.com).

For example, to identify the silicon revision level using MPLAB IDE in conjunction with MPLAB ICD 2 or PICkit™ 3:

- Using the appropriate interface, connect the device to the MPLAB ICD 2 programmer/ debugger or PICkit™ 3.
- 2. From the main menu in MPLAB IDE, select <u>Configure>Select Device</u>, and then select the target part number in the dialog box.
- 3. Select the MPLAB hardware tool (<u>Debugger>Select Tool</u>).
- Perform a "Connect" operation to the device (<u>Debugger>Connect</u>). Depending on the development tool used, the part number and Device Revision ID value appear in the **Output** window.

Note: If you are unable to extract the silicon revision level, please contact your local Microchip sales office for assistance.

The DEVREV values for the various PIC24FV32KA304 family silicon revisions are shown in Table 1.

TABLE 1: SILICON DEVREV VALUES

Part Number	Device ID ⁽¹⁾	Revision ID for Silicon Revision ⁽²⁾			Part Number	Device ID ⁽¹⁾	_	vision ID for on Revision ⁽²⁾	
		A 4	A6	A 7			A 4	A6	A 7
PIC24F32KA304	4516h				PIC24FV32KA304	4517h			
PIC24F32KA302	4512h			00007h	PIC24FV32KA302	4513h		0006h	0007h
PIC24F32KA301	4518h	0004h	0006h		PIC24FV32KA301	4519h	0004h		
PIC24F16KA304	4506h	000411	000611	0000711	PIC24FV16KA304	4507h	000411		
PIC24F16KA302	4502h				PIC24FV16KA302	4503h			
PIC24F16KA301	4508h				PIC24FV16KA301	4509h			

- **Note 1:** The Device IDs (DEVID and DEVREV) are located at the last two implemented addresses of configuration memory space. They are shown in hexadecimal in the format, "DEVID DEVREV".
 - 2: Refer to the "PIC24FXXKA1XX/FVXXKA3XX Family Flash Programming Specifications" (DS39919) for detailed information on Device and Revision IDs for your specific device.

TABLE 2: SILICON ISSUE SUMMARY

Module	Feature	Item	Issue Summary		Affected Revisions ⁽¹⁾		
		Number		A4	A6	A 7	
Core	Low-Voltage Regulator	1.	High-voltage programming entry unavailable in Low-Voltage Sleep modes.	Х			
Reset	BOR	2.	Unexpected BOR events when BOR is disabled in Sleep mode.	Х	Х	Х	
A/D	Threshold Detect	3.	Auto-scan feature may not trigger correctly in Sleep mode.	Х			
UART	TX Buffer	4.	Out-of-order transmit data when buffer is filled.	Х			
UART	Transmit	5.	UTXBF flag may not indicate correctly.	Х			
A/D	Threshold Detect	6.	Current in Auto-Scan mode may exceed expected values.	Χ			
A/D	Threshold Detect	7.	Interrupt may not trigger in certain Auto-Scan modes.	Χ			
HLVD	DC18 Value Changes	8.	Change in trip points.	X	Х	Х	

Note 1: Only those issues indicated in the last column apply to the current silicon revision.

Silicon Errata Issues

Note:

This document summarizes all silicon errata issues from all revisions of silicon, previous as well as current. Only the issues indicated by the shaded column in the following tables apply to the current silicon revision (A7).

1. Module: Core (Low-Voltage Regulator)

When operating in Low-Voltage Sleep mode, LVREN = 1 (RCON<12>) and LVRCFG = 0 (FPOR<2>), the device may not be able to enter programming modes using high-voltage entry (VIHH applied to \overline{MCLR}).

Work around

If entry into a programming mode is required while the device is in Low-Voltage Sleep mode, use <u>low-voltage</u> entry into programming. Verify that MCLR functionality is enabled, MCLRE = 1 (FPOR<7>), before attempting programming.

Affected Silicon Revisions

A4	A6	A 7			
Χ					

2. Module: Reset (BOR)

Under certain conditions, the device may improperly perform a Brown-out Reset upon wake-up from a Sleep mode. This has been observed under two conditions:

- When the BOR is disabled in Sleep mode, BOREN<1:0> = 10 (FPOR<1:0>), a BOR may occur when the device wakes from Sleep, regardless of the supply voltage.
- 2. When the BOR is configured for software control (BOREN<1:0> = 01), the device enters and wakes from Sleep normally while the BOR is disabled in software, SBOREN = 0 (RCON<13>). However, if the BOR was disabled prior to entering Sleep mode and is subsequently enabled after waking from Sleep, a BOR may occur, regardless of the supply voltage.

BOR functions normally when it is always enabled or disabled (BOREN<1:0> = 11 or 00).

Work around

Do not use Sleep mode when BOREN<1:0> = 10.

If the BOR is to operate under software control, always enable the HLVD module, HLVDEN = 1 (HLVDCON<15>), before enabling the BOR in software (SBOREN = 1). This procedure activates the internal band gap reference and assures its stability for the BOR circuit.

Affected Silicon Revisions

A4	A6	A 7			
Χ	Χ	Χ			

3. Module: A/D (Threshold Detect)

When the auto-scan feature of the Threshold Detect is enabled (AD1CON5<15> = 1), automatic scan may fail when these conditions occur together:

- · the Device is in Sleep mode, and
- Timer1 is selected as the sample trigger clock source (AD1CON1<7:4> = 0101).

Timer1 and other timers will function correctly as sample triggers in other power-saving modes, such as Idle mode.

Work around

If auto-scan functionality is required during Sleep, use INT0 as the sample trigger.

Affected Silicon Revisions

A4	A6	A 7			
Χ					

4. Module: UART (TX Buffer)

If the transmit buffer is filled sequentially with four characters, the characters may not be transmitted in the correct order.

Work around

Do not completely fill the buffer before transmitting data; send three characters or less at a time.

Affected Silicon Revisions

A4	A6	A 7			
Χ					

5. Module: UART (Transmit)

The UARTx Transmit Buffer Full flag, UTXBF (UxSTA<9>), may become cleared before data starts moving out of the full buffer. If the flag is used to determine when data can be written to the buffer, new data may not be accepted and data may not be transmitted.

Work around

Poll the Transmit Buffer Empty flag (TRMT, UxSTA<8>) to determine when the transmit buffer is empty and can be written to.

Alternatively, configure the UART to set the UARTx Transmit Interrupt Flag (UxTXIF) whenever a character is shifted into the Transmit Shift Register (UTXISEL<1:0> = 00). When a transmit interrupt occurs, this indicates that at least one buffer position is open and that the buffer can be written to.

Affected Silicon Revisions

A4	A6	A7			
Χ					

6. Module: A/D (Threshold Detect)

In Auto-Scan mode, with low power enabled (AD1CON5<15> = 1, AD1CON5<14> = 1) and the device in Sleep mode, the ADRC may not turn off between scans, resulting in a higher current draw than anticipated.

Work around

None.

Affected Silicon Revisions

A4	A6	A7			
Χ					

7. Module: A/D (Threshold Detect)

In Auto-Scan mode (AD1CON5<15> = 1), when the Auto-Scan Interrupt mode bits are set to '11' (AD1CON5<9:8> = 11), the highest number channel selected for scanning in AD1CSSL or AD1CSSH may not trigger an interrupt on a valid comparison.

Work around

Add a dummy channel to the scanning sequence. For example, when scanning ANO and AN1, set AD1CSSL to 0x0007 or 0x8003, or whatever is practical given the implementation.

Also, if the highest number channel needs to be scanned, the AD1CHITH register can be polled to observe a valid comparison.

Affected Silicon Revisions

A4	A6	A7			
Χ					

8. Module: HLVD (DC18 Value Changes)

The maximum and minimum values of the High/Low-Voltage Detect Characteristics (DC18), shown in Table 29-4 of the data sheet, have changed for this revision. The new values are shown in Table 3.

Affected Silicon Revisions

A4	A6	A 7			
Χ	Χ	Х			

TABLE 3: HIGH/LOW-VOLTAGE DETECT CHARACTERISTICS

Standard Operating Conditions: 1.8V to 3.6V PIC24F32KA3XX 2.0V to 5.5V PIC24FV32KA3XX Operating temperature $-40^{\circ}\text{C} \le \text{TA} \le +85^{\circ}\text{C}$ for Industrial

Operating temperature -40 C ≤ TA ≤ +85 C for industrial									
Param No.	Symbol	Chara	acteristic	Min	Тур	Max	Units	Conditions	
DC18	VHLVD	HLVD Voltage on	HLVDL<3:0> = 0000 ⁽²⁾	_	_	2.01	V		
		VDD Transition	HLVDL<3:0> = 0001	1.91	_	2.25	V		
			HLVDL<3:0> = 0010	2.12	_	2.48	V		
			HLVDL<3:0> = 0011	2.27		2.67	V		
			HLVDL<3:0> = 0100	2.36		2.76	V		
			HLVDL<3:0> = 0101	2.55		2.99	V		
			HLVDL<3:0> = 0110	2.79	-	3.27	V		
			HLVDL<3:0> = 0111	2.93	_	3.43	V		
			HLVDL<3:0> = 1000	3.06	_	3.60	V		
			HLVDL<3:0> = 1001	3.23	_	3.79	V		
			HLVDL<3:0> = 1010 ⁽¹⁾	3.40	_	4.00	V		
			HLVDL<3:0> = 1011 ⁽¹⁾	3.61	_	4.23	V		
			HLVDL<3:0> = 1100 ⁽¹⁾	3.83		4.49	V		
			HLVDL<3:0> = 1101 ⁽¹⁾	4.08	_	4.80	V		
			HLVDL<3:0> = 1110 ⁽¹⁾	4.38	_	5.14	V		

Note 1: These trip points should not be used on PIC24FXXKA30X devices.

2: This trip point should not be used on PIC24FVXXKA30X devices.

Data Sheet Clarifications

The following typographic corrections and clarifications are to be noted for the latest version of the device data sheet (DS39995 \mathbf{D}):

1. Module: Electrical Characteristics

The extended temperature data, shown in bold, has been added to Table 29-21.

TABLE 29-21: AC CHARACTERISTICS: INTERNAL RC ACCURACY

AC CH	HARACTERISTICS		rd Opera	· ·		1.8V to 3.6V PIC24F32 2.0V to 5.5V PIC24FV3: -40°C \leq TA \leq +85°C for -40°C \leq TA \leq +125°C fo	2KA3XX Industrial		
Param No.	Characteristic	Min	Тур	Max	Units	nits Conditions			
F20	Internal FRC Accur	acy @ 8	MHz ⁽¹⁾						
	FRC	-2	_	+2	%	+25°C	$3.0V \le VDD \le 3.6V$, F device $3.2V \le VDD \le 5.5V$, FV device		
		-5	_	+5	%	$-40^{\circ}\text{C} \le \text{TA} \le +85^{\circ}\text{C}$	$1.8V \le VDD \le 3.6V$, F device $2.0V \le VDD \le 5.5V$, FV device		
		-6	_	+6	%	$-40^{\circ}\text{C} \leq \text{Ta} \leq +125^{\circ}\text{C} \qquad 1.8\text{V} \leq \text{Vdd} \leq 3.6\text{V, F dev} \\ 2.0\text{V} \leq \text{Vdd} \leq 5.5\text{V, FV de}$			
F21	LPRC @ 31 kHz ⁽²⁾								
		-15	_	15	%		·		

Note 1: Frequency is calibrated at +25°C and 3.3V. The OSCTUN bits can be used to compensate for temperature drift

^{2:} The change of LPRC frequency as VDD changes.

APPENDIX A: DOCUMENT REVISION HISTORY

Rev A Document (3/2011)

Initial release of this document; issued for revision A4. Includes silicon issues 1 (Core, Low-Voltage Regulator) and 2 (Reset, BOR).

Rev B Document (5/2011)

Adds silicon issue 3 (A/D, Threshold Detect) to silicon revision A4.

Adds data sheet clarifications 1 (Overview and Other Locations), 2 (Overview) and 3 (A/D, Threshold Detect) for data sheet revision B.

Rev C Document (9/2011)

Adds silicon issues 4 (UART, TX Buffer), 5 (UART, Transmit), 6 (A/D, Threshold Detect), 7 (A/D, Threshold Detect) and 8 (HLVD, DC18 Value Changes) to silicon revision A4. Typographical correction in issue 1 (Core, Low-Voltage Regulator).

Adds data sheet clarifications 4 through 7 (A/D Converter), 8 and 9 (Comparator), 10 (Flash Program Memory), 11 (Electrical Specifications), 12 (A/D Converter) and 13 (Pin Diagrams) to data sheet revision B.

Rev D Document (8/2012)

Adds latest silicon revision (A6) and shows that both silicon issues 2 (Reset, BOR) and 8 (HLVD, DC18 Value Changes) are affected. Removes all data sheet clarifications that were addressed in the latest release of the data sheet.

Rev E Document (11/2013)

Adds data sheet clarification 1 (Electrical Characteristics.

Rev F Document (7/2015)

Adds current silicon revision A7.

NOTES:

Note the following details of the code protection feature on Microchip devices:

- Microchip products meet the specification contained in their particular Microchip Data Sheet.
- Microchip believes that its family of products is one of the most secure families of its kind on the market today, when used in the intended manner and under normal conditions.
- There are dishonest and possibly illegal methods used to breach the code protection feature. All of these methods, to our
 knowledge, require using the Microchip products in a manner outside the operating specifications contained in Microchip's Data
 Sheets. Most likely, the person doing so is engaged in theft of intellectual property.
- · Microchip is willing to work with the customer who is concerned about the integrity of their code.
- Neither Microchip nor any other semiconductor manufacturer can guarantee the security of their code. Code protection does not mean that we are guaranteeing the product as "unbreakable."

Code protection is constantly evolving. We at Microchip are committed to continuously improving the code protection features of our products. Attempts to break Microchip's code protection feature may be a violation of the Digital Millennium Copyright Act. If such acts allow unauthorized access to your software or other copyrighted work, you may have a right to sue for relief under that Act.

Information contained in this publication regarding device applications and the like is provided only for your convenience and may be superseded by updates. It is your responsibility to ensure that your application meets with your specifications. MICROCHIP MAKES NO REPRESENTATIONS OR WARRANTIES OF ANY KIND WHETHER EXPRESS OR IMPLIED, WRITTEN OR ORAL, STATUTORY OR OTHERWISE, RELATED TO THE INFORMATION, INCLUDING BUT NOT LIMITED TO ITS CONDITION, QUALITY, PERFORMANCE, MERCHANTABILITY OR FITNESS FOR PURPOSE. Microchip disclaims all liability arising from this information and its use. Use of Microchip devices in life support and/or safety applications is entirely at the buyer's risk, and the buyer agrees to defend, indemnify and hold harmless Microchip from any and all damages, claims, suits, or expenses resulting from such use. No licenses are conveyed, implicitly or otherwise, under any Microchip intellectual property rights unless otherwise stated.

Trademarks

The Microchip name and logo, the Microchip logo, dsPIC, FlashFlex, flexPWR, JukeBlox, KEELoQ, KEELoQ logo, Kleer, LANCheck, MediaLB, MOST, MOST logo, MPLAB, OptoLyzer, PIC, PICSTART, PIC³² logo, RightTouch, SpyNIC, SST, SST Logo, SuperFlash and UNI/O are registered trademarks of Microchip Technology Incorporated in the U.S.A. and other countries.

The Embedded Control Solutions Company and mTouch are registered trademarks of Microchip Technology Incorporated in the U.S.A.

Analog-for-the-Digital Age, BodyCom, chipKIT, chipKIT logo, CodeGuard, dsPICDEM, dsPICDEM.net, ECAN, In-Circuit Serial Programming, ICSP, Inter-Chip Connectivity, KleerNet, KleerNet logo, MiWi, MPASM, MPF, MPLAB Certified logo, MPLIB, MPLINK, MultiTRAK, NetDetach, Omniscient Code Generation, PICDEM, PICDEM.net, PICkit, PICtail, RightTouch logo, REAL ICE, SQI, Serial Quad I/O, Total Endurance, TSHARC, USBCheck, VariSense, ViewSpan, WiperLock, Wireless DNA, and ZENA are trademarks of Microchip Technology Incorporated in the U.S.A. and other countries.

 $\ensuremath{\mathsf{SQTP}}$ is a service mark of Microchip Technology Incorporated in the U.S.A.

Silicon Storage Technology is a registered trademark of Microchip Technology Inc. in other countries.

GestIC is a registered trademark of Microchip Technology Germany II GmbH & Co. KG, a subsidiary of Microchip Technology Inc., in other countries.

All other trademarks mentioned herein are property of their respective companies.

© 2011-2015, Microchip Technology Incorporated, Printed in the U.S.A., All Rights Reserved.

ISBN: 978-1-63277-628-0

QUALITY MANAGEMENT SYSTEM CERTIFIED BY DNV = ISO/TS 16949=

Microchip received ISO/TS-16949:2009 certification for its worldwide headquarters, design and wafer fabrication facilities in Chandler and Tempe, Arizona; Gresham, Oregon and design centers in California and India. The Company's quality system processes and procedures are for its PIC® MCUs and dsPIC® DSCs, KEELOQ® code hopping devices, Serial EEPROMs, microperipherals, nonvolatile memory and analog products. In addition, Microchip's quality system for the design and manufacture of development systems is ISO 9001:2000 certified.



Worldwide Sales and Service

AMERICAS

Corporate Office 2355 West Chandler Blvd. Chandler, AZ 85224-6199

Tel: 480-792-7200 Fax: 480-792-7277 Technical Support:

http://www.microchip.com/support

Web Address:

www.microchip.com
Atlanta

Duluth, GA Tel: 678-957-9614 Fax: 678-957-1455

Austin, TX Tel: 512-257-3370

Boston

Westborough, MA Tel: 774-760-0087 Fax: 774-760-0088

Chicago Itasca, IL

Tel: 630-285-0071 Fax: 630-285-0075

Cleveland

Independence, OH Tel: 216-447-0464 Fax: 216-447-0643

Dallas

Addison, TX Tel: 972-818-7423 Fax: 972-818-2924

Detroit Novi, MI

Tel: 248-848-4000

Houston, TX Tel: 281-894-5983

Indianapolis Noblesville, IN Tel: 317-773-8323

Fax: 317-773-5453 Los Angeles

Mission Viejo, CA Tel: 949-462-9523 Fax: 949-462-9608

New York, NY Tel: 631-435-6000

San Jose, CA Tel: 408-735-9110

Canada - Toronto Tel: 905-673-0699 Fax: 905-673-6509

ASIA/PACIFIC

Asia Pacific Office

Suites 3707-14, 37th Floor Tower 6, The Gateway Harbour City, Kowloon

Hong Kong

Tel: 852-2943-5100 Fax: 852-2401-3431

Australia - Sydney Tel: 61-2-9868-6733

Fax: 61-2-9868-6733

China - Beijing

Tel: 86-10-8569-7000 Fax: 86-10-8528-2104

China - Chengdu Tel: 86-28-8665-5511 Fax: 86-28-8665-7889

China - Chongqing Tel: 86-23-8980-9588 Fax: 86-23-8980-9500

China - Dongguan Tel: 86-769-8702-9880

China - Hangzhou Tel: 86-571-8792-8115 Fax: 86-571-8792-8116

China - Hong Kong SAR Tel: 852-2943-5100 Fax: 852-2401-3431

China - Nanjing Tel: 86-25-8473-2460

Fax: 86-25-8473-2470

China - Qingdao Tel: 86-532-8502-7355 Fax: 86-532-8502-7205

China - Shanghai Tel: 86-21-5407-5533

Fax: 86-21-5407-5066 China - Shenyang

Tel: 86-24-2334-2829 Fax: 86-24-2334-2393

China - Shenzhen Tel: 86-755-8864-2200

Fax: 86-755-8203-1760

China - Wuhan
Tol: 86-27-5080-5300

Tel: 86-27-5980-5300 Fax: 86-27-5980-5118

China - Xian

Tel: 86-29-8833-7252 Fax: 86-29-8833-7256

ASIA/PACIFIC

China - Xiamen

Tel: 86-592-2388138 Fax: 86-592-2388130

China - Zhuhai

Tel: 86-756-3210040 Fax: 86-756-3210049

India - Bangalore

Tel: 91-80-3090-4444 Fax: 91-80-3090-4123

India - New Delhi

Tel: 91-11-4160-8631 Fax: 91-11-4160-8632

India - Pune

Tel: 91-20-3019-1500

Japan - Osaka Tel: 81-6-6152-7160

Fax: 81-6-6152-9310 **Japan - Tokyo**

Tel: 81-3-6880- 3770 Fax: 81-3-6880-3771

Korea - Daegu Tel: 82-53-744-4301

Tel: 82-53-744-4301 Fax: 82-53-744-4302

Korea - Seoul Tel: 82-2-554-7200

Fax: 82-2-558-5932 or 82-2-558-5934

Malaysia - Kuala Lumpur Tel: 60-3-6201-9857

Fax: 60-3-6201-9859

Malaysia - Penang Tel: 60-4-227-8870

Fax: 60-4-227-4068

Philippines - Manila

Tel: 63-2-634-9065 Fax: 63-2-634-9069

Singapore

Tel: 65-6334-8870 Fax: 65-6334-8850

Taiwan - Hsin Chu Tel: 886-3-5778-366

Fax: 886-3-5770-955

Taiwan - Kaohsiung Tel: 886-7-213-7828

Taiwan - Taipei

Tel: 886-2-2508-8600 Fax: 886-2-2508-0102

Thailand - Bangkok Tel: 66-2-694-1351 Fax: 66-2-694-1350

EUROPE

Austria - Wels

Tel: 43-7242-2244-39 Fax: 43-7242-2244-393

Denmark - Copenhagen

Tel: 45-4450-2828 Fax: 45-4485-2829

France - Paris

Tel: 33-1-69-53-63-20 Fax: 33-1-69-30-90-79

Germany - Dusseldorf Tel: 49-2129-3766400

Germany - Karlsruhe Tel: 49-721-625370

Germany - Munich Tel: 49-89-627-144-0

Fax: 49-89-627-144-44 Italy - Milan

Tel: 39-0331-742611 Fax: 39-0331-466781

Italy - Venice Tel: 39-049-7625286

Netherlands - Drunen Tel: 31-416-690399

Fax: 31-416-690340

Poland - Warsaw Tel: 48-22-3325737

Spain - Madrid

Tel: 34-91-708-08-90 Fax: 34-91-708-08-91

Sweden - Stockholm Tel: 46-8-5090-4654

UK - Wokingham Tel: 44-118-921-5800 Fax: 44-118-921-5820

07/14/15